# **Technical Publication**

W&C-TRR<br/>Rear Suspension SystemFor Yutong<br/>Mixer Trucks



**SUBJECT:** Service Instructions **DATE:** September 2023

LIT NO: W&C283 TP REVISION: A



## **TABLE OF CONTENTS**

Introduction
Product Description
Important Safety Notice
Special Tools
Parts Lists8
Preventive Maintenance
Watson & Chalin China
Recommended Inspection Intervals 12
Component Inspection
Progressive Load Spring13
Tie-bar Bolster Springs13
Rebound Straps
Axle Bracket14
Equalizing Beam End Connection 15
Bar Pin End Bushing16
V-torque Rods16

Section 7	Alignment & Adjustments
	Drive Axle Alignment
Section 8	Component Replacement
	Fasteners
	Frame Hanger
	Rebound Strap19
	Tie-bar Bolster Springs20
	Progressive Load Spring21
	Saddle Assembly22
	Equalizing Beam23
	Bar Pin End Bushings24
Section 9	Troubleshooting Guide
Section 10	Torque Specifications

- --



# SECTION 1 Introduction

This publication is intended to acquaint and assist maintenance personnel in the preventive maintenance, service, repair and rebuild of the W&C-TRR rear suspension system for applicable Yutong brand mixer trucks.

#### NOTE

Use only Genuine Watson & Chalin China parts for servicing this suspension system.

It is important to read and understand this entire Technical publication prior to performing any maintenance, service, repair, or rebuild of this product. The information in this publication contains parts lists, safety information, product specifications, features, proper maintenance, service, repair and rebuild instructions for W&C-TRR suspension system.

Watson & Chalin China reserves the right to make changes and improvements to its products and publications at any time. Contact Watson & Chalin China at +86.531.8880.9055 for information on the latest version of this manual.

The latest revision of this publication is also available online at china.wcsuspensions-intl.com

# SECTION 2 **Product Description**

Advanced engineering design methods and experience gathered over years of experience led to the W&C-TRR, a rugged, yet lightweight rubber rear suspension that saves weight over competitive suspensions for greater payloads and route consolidation.


Suspension weight is reduced for greater payloads and improved durability through innovative design, higher strength materials and advanced manufacturing methods.

#### **MAJOR COMPONENTS INCLUDE:**

- Equalizing beam Formed and robotically-welded equalizing beam provides a narrow profile for weight savings, distributes load equally between both axles for improved traction, lowers the center of gravity to increase stability, and establishes a solid axle connection for improved handling.
- Bar pin end connection Rugged axle connection extends bushing life, and allows easy axle alignment and serviceability.
- Progressive load spring Engaged for a smooth ride and additional stability.
- Rubber tie-bar bolster springs The unique design works with the progressive load spring to deliver enhanced empty ride quality and loaded stability.



#### FIGURE 2-1

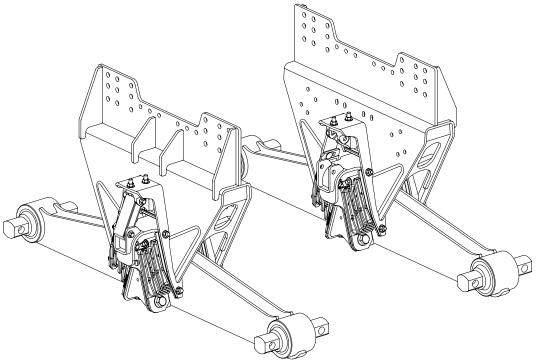

## W&C-TRR SPECIFICATIONS

Suspension Weight <sup>1</sup> (1350 mm beam length)	363 Kilograms
Suspension Rating	25 Metric Tons
Gross Combination Weight (GCW) Approval	36 Metric Tons
Diagonal Articulation <sup>2</sup>	280 Millimeters
Ride Heights (loaded) <sup>3</sup>	250 Millimeters
Axle Spacing <sup>4</sup>	1,350 Millimeters

Watson & Chalin China approves the use of the W&C-TRR suspension in tractors and straight trucks in the following vocational truck applications: dump, concrete mixer, refuse, logging, and crane / boom platform. All such applications must comply with applicable Watson & Chalin China specifications and must also be approved by the respective vehicle manufacturer with the vehicle in its original, as-built configuration. Contact Watson & Chalin China and the respective vehicle manufacturer for approval of additional applications.

- 1. Suspension weight does not include V-torque rods and axle brackets.
- 2. Suspension articulation may exceed vehicle's capability and may be limited by vehicle manufacturer; vehicle manufacturer installed axle stops may restrict suspension's articulation.
- 3. W&C-TRR ride height measurements are taken from the centerline of the axle to the bottom of the truck frame.
- 4. Contact Watson & Chalin China for availability of beam lengths.

# SECTION 3 Important Safety Notice

Proper maintenance, service and repair are important to the reliable operation of the suspension. The procedures recommended by Watson & Chalin China and described in this technical publication are methods of performing such maintenance, service and repair.

This technical publication should be read carefully to help prevent personal injury and to assure that proper methods are used. Improper maintenance, service or repair may damage the vehicle, cause personal injury, render the vehicle unsafe in operation, or void the manufacturer's warranty.

Failure to follow the safety precautions in this manual can result in personal injury and/or property damage. Carefully read and understand all safety related information within this publication, on all decals and in all such materials provided by the vehicle manufacturer before conducting any maintenance, service or repair.

# **EXPLANATION OF SIGNAL WORDS**

Hazard "Signal Words" (Danger-Warning-Caution) appear in various locations throughout this publication. Information accented by one of these signal words must be observed to help minimize the risk of personal injury to service personnel, or possibility of improper service methods which may damage the vehicle or render it unsafe.



DANGER

WARNING

J

A CAUTION

This is the safety alert symbol. It is used to alert you to potential personal injury hazards. Obey all safety messages that follow this symbol to avoid possible injury or death.

Additional 'Notes' or 'Service Hints' are utilized to emphasize areas of procedural importance and provide suggestions for ease of repair. The following definitions indicate the use of these signal words as they appear throughout the publication.

INDICATES AN IMMINENTLY HAZARDOUS SITUATION, WHICH, IF NOT AVOIDED, WILL RESULT IN SERIOUS INJURY OR DEATH.

INDICATES A POTENTIAL HAZARDOUS SITUATION, WHICH, IF NOT AVOIDED, CAN RESULT IN DEATH OR SERIOUS INJURY.

INDICATES A POTENTIAL HAZARDOUS SITUATION, WHICH, IF NOT AVOIDED, MAY RESULT IN MINOR OR MODERATE INJURY.

NOTE	An operating procedure, practice condition, etc., which is essential to emphasize.	
SERVICE HINT	A helpful suggestion that will make the service being performed a little easier and/or faster.	
	Also note that particular service operations may require the use of special tools designed for specific purposes. These special tools can be found in the Special Tools Section of this publication.	

The torque symbol alerts you to tighten fasteners to a specified torque value. Refer to Torque Specifications Section of this publication.



## SAFETY PRECAUTIONS

### A WARNING

FASTENERS

DISCARD USED FASTENERS. ALWAYS USE NEW FASTENERS TO COMPLETE A REPAIR. FAILURE TO DO SO COULD RESULT IN FAILURE OF THE PART OR MATING PARTS, ADVERSE VEHICLE HANDLING, PERSONAL INJURY, OR PROPERTY DAMAGE.

LOOSE OR OVER TORQUED FASTENERS CAN CAUSE COMPONENT DAMAGE, ADVERSE VEHICLE HANDLING, PROPERTY DAMAGE, OR SEVERE PERSONAL INJURY. MAINTAIN CORRECT TORQUE VALUES AT ALL TIMES. CHECK TORQUE VALUES ON A REGULAR BASIS AS SPECIFIED, USING A TORQUE WRENCH THAT IS REGULARLY CALIBRATED. TORQUE VALUES SPECIFIED IN THIS TECHNICAL PUBLICATION ARE FOR WATSON & CHALIN CHINA SUPPLIED FASTENERS ONLY. IF NON-WATSON & CHALIN CHINA FASTENERS ARE USED, FOLLOW TORQUE SPECIFICATION LISTED IN THE VEHICLE MANUFACTURER'S SERVICE MANUAL.

## 

#### LOAD CAPACITY

ADHERE TO THE PUBLISHED CAPACITY RATINGS FOR THE SUSPENSION. ADD-ON AXLE ATTACHMENTS AND OTHER LOAD TRANSFERRING DEVICES CAN INCREASE THE SUSPENSION LOAD ABOVE ITS RATED AND APPROVED CAPACITIES, WHICH CAN RESULT IN COMPONENT DAMAGE AND ADVERSE VEHICLE HANDLING, POSSIBLY CAUSING PERSONAL INJURY OR PROPERTY DAMAGE.

#### WARNING MODIFYING COMPONENTS

DO NOT MODIFY OR REWORK PARTS WITHOUT AUTHORIZATION FROM WATSON & CHALIN CHINA. DO NOT SUBSTITUTE REPLACEMENT COMPONENTS NOT AUTHORIZED BY WATSON & CHALIN CHINA. USE OF MODIFIED, REWORKED, SUBSTITUTE OR REPLACEMENT PARTS NOT AUTHORIZED BY WATSON & CHALIN CHINA MAY NOT MEET WATSON & CHALIN CHINA'S SPECIFICATIONS, AND CAN RESULT IN FAILURE OF THE PART, ADVERSE VEHICLE HANDLING, POSSIBLE PERSONAL INJURY OR PROPERTY DAMAGE, AND WILL VOID WARRANTY. USE ONLY WATSON & CHALIN CHINA AUTHORIZED REPLACEMENT PARTS.

## 

#### **TORCH/WELDING**

DO NOT USE A CUTTING TORCH TO REMOVE ANY FASTENERS. THE USE OF HEAT ON SUSPENSION COMPONENTS WILL ADVERSELY AFFECT THE STRENGTH OF THESE PARTS. A COMPONENT DAMAGED IN THIS MANNER CAN RESULT IN THE ADVERSE VEHICLE HANDLING AND POSSIBLE PERSONAL INJURY OR PROPERTY DAMAGE.

EXERCISE EXTREME CARE WHEN HANDLING OR PERFORMING MAINTENANCE IN THE AREA OF THE EQUALIZING BEAM. DO NOT CONNECT ARC WELDING GROUND LINE TO THE EQUALIZING BEAM. DO NOT STRIKE AN ARC WITH THE ELECTRODE ON THE EQUALIZING BEAM AND AXLE. DO NOT USE HEAT NEAR THE EQUALIZING BEAM ASSEMBLY. DO NOT NICK OR GOUGE THE EQUALIZING BEAM. SUCH IMPROPER ACTIONS CAN DAMAGE THE EQUALIZING BEAM ASSEMBLY, AND CAN CAUSE ADVERSE VEHICLE HANDLING AND POSSIBLE PERSONAL INJURY OR PROPERTY DAMAGE.



#### PERSONAL PROTECTIVE EQUIPMENT

ALWAYS WEAR PROPER EYE PROTECTION AND OTHER REQUIRED PERSONAL PROTECTIVE EQUIPMENT TO HELP PREVENT PERSONAL INJURY WHEN PERFORMING VEHICLE MAINTENANCE, REPAIR OR SERVICE.



#### **PROCEDURES AND TOOLS**

A TECHNICIAN USING A SERVICE PROCEDURE OR TOOL WHICH HAS NOT BEEN RECOMMENDED BY WATSON & CHALIN CHINA MUST FIRST SATISFY THEMSELVES THAT NEITHER THEIR SAFETY NOR THE VEHICLE'S SAFETY WILL BE JEOPARDIZED BY THE METHOD OR TOOL SELECTED. INDIVIDUALS DEVIATING IN ANY MANNER FROM THE INSTRUCTIONS PROVIDED WILL ASSUME ALL RISKS OF CONSEQUENTIAL PERSONAL INJURY OR DAMAGE TO EQUIPMENT INVOLVED.



#### SUPPORT THE VEHICLE PRIOR TO SERVICING

PLACE THE VEHICLE ON A LEVEL FLOOR AND CHOCK THE WHEELS TO PREVENT THE VEHICLE FROM MOVING OR ROLLING. DO NOT WORK AROUND OR UNDER A RAISED VEHICLE SUPPORTED BY ONLY A FLOOR JACK OR OTHER LIFTING DEVICE. ALWAYS SUPPORT A RAISED VEHICLE WITH RIGID SAFETY STANDS. FAILURE TO DO SO CAN CAUSE SERIOUS PERSONAL INJURY OR DAMAGE TO EQUIPMENT.



## **A**CAUTION

#### IMPROPER VEHICLE LIFT OR SUPPORT METHOD

IMPROPER VEHICLE LIFT OR SUPPORT METHOD CAN CAUSE DAMAGE TO THE SUSPENSION TIE-BAR BOLSTER SPRINGS, AND CAN VOID ANY WARRANTY COVERAGE. DO NOT LIFT OR SUPPORT THE VEHICLE AT ONLY ONE OF THE TWO REAR DRIVE AXLES. WHEN LIFTING OR SUPPORTING THE VEHICLE USING THE DRIVE AXLES, ENSURE BOTH DRIVE AXLES ARE LIFTED AND SUPPORTED TOGETHER. READ, UNDERSTAND AND COMPLY WITH ANY ADDITIONAL VEHICLE LIFT AND SUPPORT INSTRUCTIONS PROVIDED BY THE VEHICLE MANUFACTURER OR LIFT EQUIPMENT MANUFACTURER.

## WARNING V-TORQUE RODS

FOR VEHICLE STABILITY THE W&C-TRR SUSPENSION INCORPORATES V-TORQUE RODS SUPPLIED BY VEHICLE MANUFACTURER. IF THESE COMPONENTS ARE DISCONNECTED OR ARE NON-FUNCTIONAL THE VEHICLE SHOULD NOT BE OPERATED. FAILURE TO DO SO CAN RESULT IN ADVERSE VEHICLE HANDLING AND POSSIBLE TIRE CONTACT WITH THE FRAME.

## A WARNING PARTS CLEANING

SOLVENT CLEANERS CAN BE FLAMMABLE, POISONOUS, AND CAUSE BURNS. TO HELP AVOID SERIOUS PERSONAL INJURY, CAREFULLY FOLLOW THE MANUFACTURER'S PRODUCT INSTRUCTIONS AND GUIDELINES AND THE FOLLOWING PROCEDURES:

- 1. WEAR PROPER EYE PROTECTION.
- 2. WEAR CLOTHING THAT PROTECTS YOUR SKIN.
- 3. WORK IN A WELL-VENTILATED AREA.
- 4. DO NOT USE GASOLINE OR SOLVENTS THAT CONTAIN GASOLINE. GASOLINE CAN EXPLODE.
- 5. ACIDIC SOLUTIONS CANNOT BE USED ON ALUMINUM COMPONENTS.
- 6. HOT SOLUTION TANKS OR ALKALINE SOLUTIONS MUST BE USED CORRECTLY. FOLLOW THE MANUFACTURER'S RECOMMENDED INSTRUCTIONS AND GUIDELINES CAREFULLY TO HELP PRE-VENT PERSONAL ACCIDENT OR INJURY.

DO NOT USE HOT SOLUTION TANKS OR WATER AND ALKALINE SOLUTIONS TO CLEAN GROUND OR POLISHED PARTS. DOING SO WILL CAUSE DAMAGE TO THE PARTS AND VOID WARRANTY.



# SECTION 4 Special Tools

#### **BAR PIN STYLE END BUSHING TOOLS**

INSTALLATION TOOLS Watson & Chalin China Part No. 066086-103

OTC Part No. 1757 Visit otctools.com




Use with the beam removed from the truck, and in conjunction with OTC No. 51100 press plate and a 100 tonne hydraulic shop press. REMOVAL TOOLS Watson & Chalin China Part No. 066086-104

OTC Part No. 206457 Visit otctools.com




Watson & Chalin China Part No. 066086-105 OTC Part No. 302030 Visit otctools.com



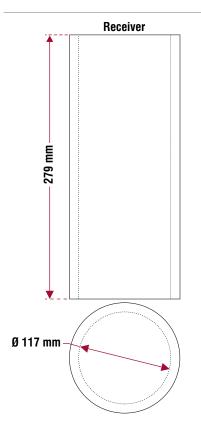



# SECTION 5 Parts Lists

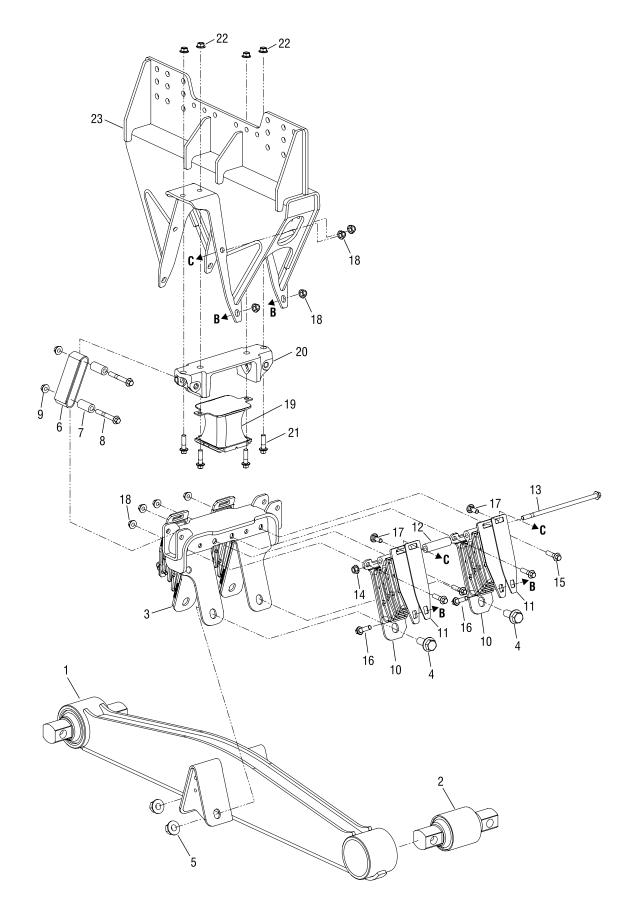



KEY I	NO. PART NO.	DESCRIPTION	VEHICLE QTY.
	024462-006	Equalizing Beam Service Kit, One B Includes Key Nos. 1-2, 4-5	eam,
		*Equalizing Beam Assembly, 1350 n Includes Key Nos. 1-2	nm 2
1		*Equalizing Beam, 1350 mm	2
2		*Bar Pin End Bushing	4
	024462-002	Saddle Assembly Service Kit, One S Includes Key Nos. 3-5, 8, 15, 18	Saddle,
3		*Saddle Assembly	2
3 4		*M20 x 1.5-6g x 50 mm Flange Bolt	8
5		*M20 x 1.5 Flange Nut	8
	060961-806	Rebound Strap Service Kit, One Str	ap,
		Includes Key Nos. 6-9	
6		*Rebound Strap	2
7		*Rebound Spacer	4
8		*M12 x 1.75-6g x 90 mm Flange Bo	lt 4
9		*M12 x 1.75 Flange Locknut	4
		Tie-Bar Bolster Spring Service Kits	
	024462-003	Two Bolster Springs, Includes Key	Nos. 4-5, 10-18
	024462-004	Four Bolster Springs, Includes Key	Nos. 4-5, 10-18


KEY	NO. PART NO.	DESCRIPTION VE	HICLE QTY.
10		*Tie-Bar Bolster Spring	8
11		*Bolster Spring Top Plate Spacer	8
12		*Tie-Bar Bolster Spring Spacer	4
13		*M12 x 1.75-6g x 285 mm Flange Bolt	4
14		*M12 x 1.75 Flange Locknut	4
15		*M12 x 1.75-6g x 45 mm Flange Bolt	8
16		*M12 x 1.75-6g x 35 mm Flange Bolt	8
17		*M12 x 1.75-6g x 35 mm Round Head	8
		Square Neck Bolt	
18		*M12 x 1.75 Flange Locknut	32
	024462-005	Progressive Load Spring Service Kit,	
		One Spring, Includes Key Nos. 8,19, 21	-22
19		*Progressive Load Spring	2
20	077234-050	Load Spring Rebound Bracket	22
21		*M12 x 1.75-6g x 45 mm Flange Bolt	8
22		*M12 x 1.75 Flange Locknut	8
23	077995-403	Frame Hanger	2

#### **W&C-TRR CROSS REFERENCE**


WATSON & CHALIN CHINA	A YUTONG	
PART NO.	PART NO.	DESCRIPTION
024462-006	2918-00511	Equalizing Beam Service Kit, One Beam
024462-002	2918-00512	Saddle Assembly Service Kit, One Saddle
024462-003	2918-00513	Tie-Bar Bolster Spring Service Kit, Two Bolster Springs
024462-004	2918-00514	Tie-Bar Bolster Spring Service Kit, Four Bolster Springs
024462-005	2918-00515	Progressive Load Spring Service Kit, One Spring
060961-806	2918-00516	Rebound Strap Service Kit, One Strap
077234-050	2918-00517	Load Spring Rebound Bracket
077995-403	2918-00518	Frame Hanger


NOTES: \* Item included in assembly or service kit only, part not sold separately.

V-torque rods are not supplied by Watson & Chalin China, although it is a required component. Watson & Chalin China is not responsible for components supplied by the vehicle manufacturer. For assistance with inspection, maintenance and rebuild instructions on these components see vehicle manufacturer.

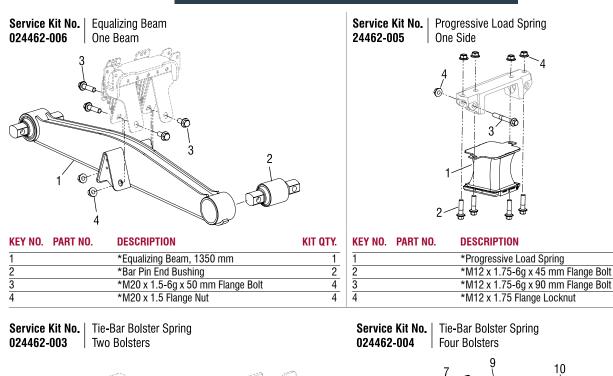

**W&C-TRR Service Kits** 

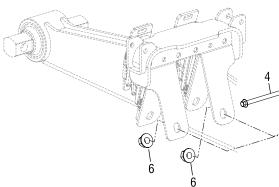

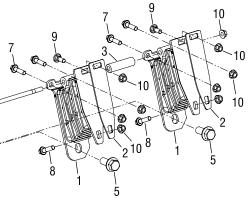

KEY NO. PART NO.	DESCRIPTION	KIT QTY.	KEY NO.	PART NO.	DESCRIPTION	KIT QTY.
1	*Tie-Bar Bolster Spring	2	1		*Tie-Bar Bolster Spring	4
2	*Bolster Spring Top Plate Spacer	2	2		*Bolster Spring Top Plate Spacer	4
3	*Tie-Bar Bolster Spring Spacer	1	3		*Tie-Bar Bolster Spring Spacer	2
4	*M12 x 1.75-6g x 285 mm Flange Bolt	1	4		*M12 x 1.75-6g x 285 mm Flange Bolt	2
5	*M20 x 1.5-6g x 50 mm Flange Bolt	2	5		*M20 x 1.5-6g x 50 mm Flange Bolt	4
6	*M20 x 1.5 Flange Nut	2	6		*M20 x 1.5 Flange Nut	4
7	*M12 x 1.75-6g x 45 mm Flange Bolt	4	7		*M12 x 1.75-6g x 45 mm Flange Bolt	8
8	*M12 x 1.75-6g x 35 mm Flange Bolt	2	8		*M12 x 1.75-6g x 35 mm Flange Bolt	4
9	*M12 x 1.75-6g x 35 mm Round Head	2	9		*M12 x 1.75-6g x 35 mm Round Head	4
	Square Neck Bolt				Square Neck Bolt	
10	*M12 x 1.75 Flange Locknut	9	10		*M12 x 1.75 Flange Locknut	18

NOTE: \*Item included in assembly or service kit only, part not sold separately.

KIT QTY.

1

4

1



**W&C-TRR Service Kits** Service Kit No.| Saddle Assembly Service Kit No. | Rebound Strap 024462-002 One Saddle 060961-806 One Strap 5 Q .@c A CO 6 R T 2 3 3 DESCRIPTION KIT QTY. KEY NO. PART NO. DESCRIPTION KIT QTY. KEY NO. PART NO. Saddle Assembly \*Rebound Strap 1 1 1 1 \*M20 x 1.5-6g x 50 mm Flange Bolt \*M20 x 1.5 Flange Nut 2 2 \*Rebound Spacer 4 2 3 \*M12 x 1.75-6g x 90 mm Flange Bolt 2 3 4 \*M12 x 1.75-6g x 45 mm Flange Bolt \*M12 x 1.75-6g x 90 mm Flange Bolt 4 \*M12 x 1.75 Flange Locknut 2 4 4 5 1 6 \*M12 x 1.75 Flange Locknut 5

NOTE: \*Item included in assembly or service kit only, part not sold separately.



# SECTION 6 **Preventive Maintenance**

Following appropriate inspection procedures is important to help ensure the proper maintenance and operation of the W&C-TRR suspension system and component parts function to their highest efficiency. Look and replace any bent, cracked, worn or damaged parts.

WATSON & CHALIN CHINA Recommended inspection intervals	PRE-DELIVERY INSPECTION	FIRST IN-SERVICE INSPECTION	PREVENTIVE MAINTENANCE
Visually inspect suspension for proper assembly and function. Inspect the fasteners for proper torque as recommended in the Torque Specifications Section of this publication with special attention to the following suspension connections: • Saddle to equalizing beam • Equalizing beam end • Bolster springs to frame hanger • Load spring rebound bracket to frame hanger Visually inspect for proper assembly and function. Check for	- Within the first	Within the first	Every 12 months
<ul> <li>all of the following and replace components as necessary.</li> <li>Signs of unusual movement, loose or missing components</li> <li>Signs of abrasive or adverse contact with other components</li> <li>Damaged, bent or cracked parts</li> </ul>	500 Kilometers	2,000 Kilometers	
Inspect progressive load springs, rebound straps and tie-bar bolster springs	-		Every 3 months
Verify the lateral alignment of axles are within the vehicle manufacturer's tolerances			Every 12 months

## **COMPONENT INSPECTION**

Following the appropriate inspection procedures is important to help ensure the proper maintenance and operation of the W&C-TRR suspension system and component parts. Look for and replace worn, damaged, bent or cracked parts.

- Equalizing beam assembly Check the overall condition of the equalizing beam for dents, dings, or other damage. Check for any metal-to-metal contact in the equalizing beam end connections. See equalizing beam end connection inspection in this section.
- Fasteners Look for any loose or damaged fasteners on the entire suspension. Make sure all fasteners are tightened to a torque value within the specified torque range. See recommended torque specifications for Watson & Chalin China supplied fasteners in Torque Specification Section of this publication. For fasteners not supplied by Watson & Chalin China, see the vehicle manufacturer. Use a calibrated torque wrench to check torque.

Watson & Chalin China recommends the use of CL. 10.9 bolts, and CL. 10 locknuts. Washers are not necessary when flanged fasteners are used.

- Frame hangers / Saddle Look for any signs of wear and damage. Check all attaching fasteners for proper torque. Visually inspect for signs of movement on the frame rail or damage. Inspect the area around the gussets for cracks.
- Progressive load spring, tie-bar bolster spring and rebound strap See Progressive Load Spring, Tie-Bar Bolster Springs and Rebound Strap inspection in this section.
- Wear and damage Inspect all parts of the suspension for wear and damage. Look for bent or cracked parts.

See the vehicle manufacturer's applicable publications for other preventive maintenance requirements.

12

NOTE



# PROGRESSIVE LOAD SPRING

A visual inspection of the progressive load spring is required every three months.

Progressive load spring — If the progressive load spring is:

- Visual damage, replace as outlined in the **Component Replacement Section of this** publication.
- With the vehicle in the unloaded condition. measure the height of the progressive load spring from the top plate to the bottom plate, see Figure 6-1. Normal height is 119 mm, if the measurement height is 84 mm or less, replace as outlined in the Component Replacement Section of this publication.

# **TIE-BAR BOLSTER SPRINGS**

Inspect the tie-bar bolster springs every 3 months, see Figure 6-2. Actual tie-bar bolster spring service condition and performance may vary depending upon suspension and vehicle configuration, operation, service and other factors.

#### INSPECTION

The following inspection guidelines are intended to assist vehicle operators and maintenance personnel in examining the tie-bar bolster springs and determining when replacements may be needed.

In the event one tie-bar bolster spring on one side of the equalizing beam shows signs of damage or excessive wear. Watson & Chalin China recommends that both bolster springs installed on that equalizing beam be replaced, see Figure 6-2. When the bolster springs are replaced on one side only, the vehicle may lean slightly.

The new bolster springs will tend to settle to some degree, and return the vehicle to its original condition. The following procedure is recommended for proper inspection.

- 1. Chock the front wheels to prevent movement of the vehicle during inspection of the suspension.
- 2. Raise rear of vehicle approximately 100 mm to 125 mm (just prior of lifting the rear wheels off ground) and support with stands.
- 3. Inspect all tie-bar bolster springs using the following criteria. If cuts, splits, or bonding separation are detected in the rubber, measure the depth of the damaged area using a machinist scale or W&C-TRR gauge to determine if replacement is required.
  - Bent, burred or overhanging edges of the tie-bar bolster spring metal plates may occur due to mishandling in service. If the rubber is not trapped, and there are no sharp metal edges in contact with the free surface of the rubber, this condition is acceptable.
  - Creases formed by folding of the rubber surface under load are acceptable. These creases appear as stripes on the surface, polished by wear or covered with tacky rubber.
  - Minor oil and grease contamination in the rubber due to vehicle operation is acceptable. A slight change in shape of the rubber due to permanent set should not be mistaken for oil and grease contamination. Certain softening of the rubber surface is acceptable. However, unacceptable swelling due to contamination will require tie-bar bolster spring replacement. In the unloaded condition, if the bolster spring rubber is swollen beyond the edge of the metal plates, then tie-bar bolster spring replacement is necessary.


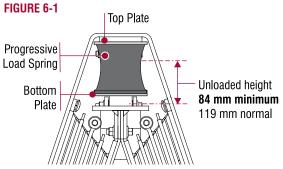


FIGURE 6-2 9] 0 Replace bolster springs in pairs on the affected side of the beam



- Cuts or Splits in the rubber of over 25 mm in length and an average depth of 10 mm are not acceptable and require tie-bar bolster spring replacement. In particular, look for signs of cuts or splits in the rubber at points indicated in Figure 6-3 as "//////".
- Bonding separation of the rubber from a bonded metal surface to a depth of up to 13 mm is acceptable. If any bonding separation is more than 13 mm deep, both bolster springs should be replaced on the affected side of the vehicle (see Figure 6-3). An unloaded bolster spring

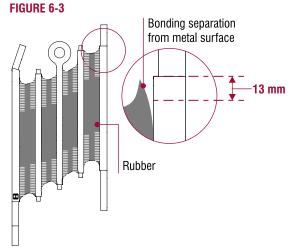


may be inspected for any bonding separation by measuring at points indicated in Figure 6-3 as "//////". Any thin film or other residual rubber material on the metal plates resulting from the molding process may be ignored during inspection.


## **REBOUND STRAPS**

The rebound straps helps prevent the overextension of the tie-bar bolster springs during vehicle operation. If the rebound strap is torn, frayed or not intact, replace as outlined in the Component Replacement Section of this publication.

# **AXLE BRACKET**

The axle brackets are furnished and welded into position by the vehicle or axle manufacturer.

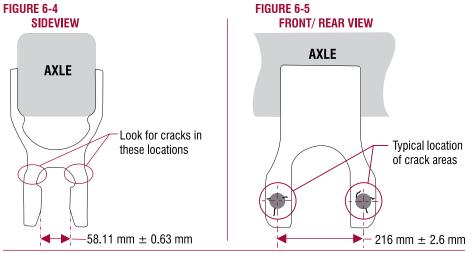

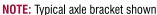

- Visual Inspection When inspecting the equalizing beam end connection also inspect the axle brackets for damage or cracks, see Figure 6-4. Any axle bracket that is found damaged or cracked must be repaired or replaced.
- Physical Inspection When an equalizing beam is removed for repair, or an inspection of the equalizing beam end connection reveals movement:
  - Inspect the axle brackets for damage or cracks in the locations shown in Figures 6-4 and 6-5. Any axle bracket that is found damaged or cracked must be repaired or replaced.
  - Measure the distance between the axle bracket legs for correct width, refer to Figures 6-4 and 6-5 for measurement location and dimensions. An axle bracket outside of the measurement range must be repaired or replaced.

Consult the vehicle manufacturer for inspection, component repair and replacement instructions.




# EQUALIZING BEAM END CONNECTION

#### **FIGURE 6-6**

The equalizing beam end connection for the **W&C-TRR** is a bar pin style rubber bushing, see Figure 6-6.

An inspection of the equalizing beam end connection is necessary when a vehicle is in the shop for major repair work or every six months, whichever comes first.

The equalizing beam end connections require that the fasteners are tightened to torgue specifications to maintain the clamp load of the axle bracket legs to the bar pin. All bushing motion is accommodated by rubber deflection.

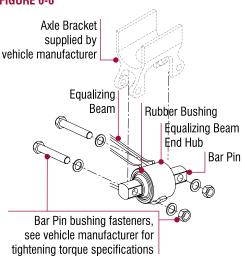


#### **VISUAL INSPECTION**

- 1. Chock the wheels.
- 2. Visually inspect the equalizing beam end connection for signs of excessive wear or looseness.

**SERVICE HINT** An equalizing beam end connection that is visibly cleaner than the other connections may indicate a loose connection.

- Look for worn, frayed or distorted rubber in the bar pin beam end bushing.
- Look for the equalizing beam to be lower in the axle bracket, see Figure 6-7.
- If the bar pin beam end bushing is visually offset a floor jack test should be performed, refer to the Physical Inspection.

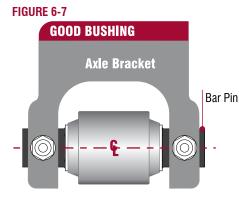


A **GOOD** bushing will result in the equalizing beam end hub appearing to be **centered** with the centerline of the bar pin in the axle bracket WORN BUSHING Axle Bracket ç

A WORN bushing will result in the equalizing beam end hub appearing to be offset/below the centerline of the bar pin in the axle bracket

#### **FIGURE 6-8**

#### PHYSICAL INSPECTION

The gap at each side of the visible rubber on the lower part of the bar pin end bushing is normal, see Figure 6-8, it is not an indication to replace the bushing. All rubber end bushings are in compression with the load bearing on the top side, the lower side of the rubber is slightly relieved, allowing the rubber to move inward, and a gap appears.

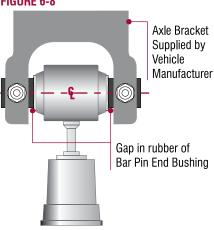

NOTE

NOTE


W&C283TP



### WARNING

IF BAR PIN END BUSHING MOVEMENT OR LOOSENESS IS NOTED IN THE FOUALIZING BEAM END HUB. DO NOT OPERATE THE VEHICLE. REPLACE THE RUBBER END BUSHINGS AND ALL CONNECTING PARTS. THE ABOVE CONDITION CAN RESULT IN COSTLY REPAIR, DOWNTIME, POSSIBLE SEPARATION OF COMPONENTS, ADVERSE VEHICLE HANDLING, PROPERTY DAMAGE, OR PERSONAL INJURY.

- 1. If bar pin movement or looseness is detected in the equalizing beam end hub, **DO NOT** operate the vehicle. Check and record torgue values, as received, for each beam end fastener.
- 2. Correct torque values as required making sure all fasteners are tightened within the vehicle manufacturer's specifications.
- 3. Recheck the equalizing beam end connections for signs of looseness.
- 4. If bar pin looseness is still detected in the equalizing beam end hub, **D0 N0T** operate the vehicle. One or more components will require replacement; see the Component Replacement Section of this publication.

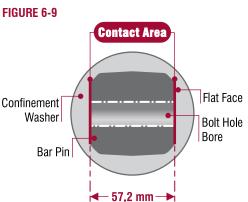

If bar pin measurement is less than 57.2 mm, replacement is required.

#### **BAR PIN END BUSHING**

#### **VISUAL INSPECTION**

An indication that the bar pin end bushing requires replacement is when one or more of the following conditions apply:

- If the contact area, see Figure 6-9 (the flat face area where bar pin contacts the axle bracket) reveal signs of excessive wear. A bar pin thickness measurement of less than 57.2 mm.
- If the bar pin bolt holes bores reveal signs of elongation or wear, see Figure 6-9.

## **V-TORQUE RODS**


V-torque rods are not supplied by Watson & Chalin China, but are a required components. Watson & Chalin China is not responsible for components supplied by the vehicle manufacturer. For assistance with inspection, maintenance and rebuild instructions on these components see vehicle manufacturer.

FOR VEHICLE STABILITY THE W&C-TRR SUSPENSION INCORPORATES V-TORQUE RODS SUPPLIED BY VEHICLE MANUFACTURER. IF THESE COMPONENTS ARE DISCONNECTED OR ARE NON-FUNCTIONAL THE VEHICLE SHOULD NOT BE OPERATED. FAILURE TO DO SO CAN RESULT IN ADVERSE VEHICLE HANDLING AND POSSIBLE TIRE CONTACT WITH THE FRAME.

FIGURE 6-10

À WARNING

NOTE

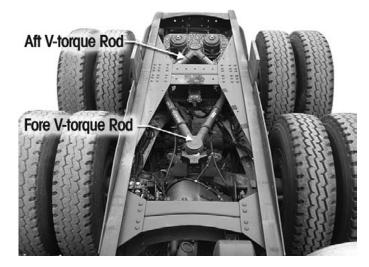

The W&C-TRR suspension is equipped by the vehicle manufacturer with V-torque rods that control axle movement during braking, accelerating, and cornering, see Figure 6-10. The mounting brackets at the axle ends of the V-torgue rods are furnished as part of the axle housings by the vehicle manufacturer or the axle manufacturer. The length of the V-torque rods is determined by the vehicle manufacturer for optimum drive line angles.

The frame rail ends are bolted into the brackets supplied by the vehicle manufacturer.

The V-torque rods must be connected and in good working condition when operating the vehicle. Consult the vehicle manufacturer for inspection, component repair or replacement instructions.



# SECTION 7 Alignment & Adjustments

# **DRIVE AXLE ALIGNMENT**

- The primary control for alignment is the location of the frame hanger assemblies as installed on the frame rails by the vehicle manufacturer, and the location of the axle brackets on the axles as installed by the axle or vehicle manufacturer. No alignment adjustment is available, refer to the vehicle manufacturer with any questions regarding lateral alignment.
- Axle centering and pinion angles are controlled by the V-torque rods. Design, layout, and installation responsibility belongs to the vehicle manufacturer. Contact the vehicle manufacturer if there are issues relating to axle centering or pinion angles.
- Ride height is controlled by the design of the suspension. No adjustment is possible. However, wear of the progressive load spring may result in slightly lower ride height over time. Replacement of worn progressive load springs should restore ride height to original specifications.



# SECTION 8 Component Replacement

NOTE

## **FASTENERS**

Watson & Chalin China recommends that when servicing a vehicle, replace all the removed fasteners with new equivalent fasteners. Maintain correct torque values at all times. Check torque values as specified. See Watson & Chalin China's Torque Specifications Section of this publication. If non-Watson & Chalin China fasteners are used, follow torque specifications listed in the vehicle manufacturer's service manual.


Watson & Chalin China recommends the use of CL 10.9 bolts, and CL 10 locknuts. Washers are not necessary when flanged fasteners are used.

## **FRAME HANGER**

#### DISASSEMBLY

- 1. Chock the front wheels of the vehicle.
- 2. Remove upper rebound strap fasteners.
- 3. Remove the M12 fasteners from the frame hanger to the tie-bar bolster springs, see Figure 8-1.

4. Remove M12 fasteners from frame hanger to load spring rebound bracket, see Figure 8-1. FIGURE 8-1

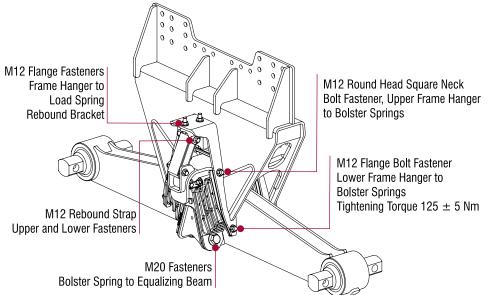

- 5. Raise the frame enough to allow a gap between the tie-bar bolster springs and the frame hanger.
- 6. Remove the frame fasteners, see manufacturer's guidelines.

THE WEIGHT OF THE FRAME HANGER IS APPROXIMATELY 51.9 KILOGRAMS. CARE SHOULD BE TAKEN AT REMOVAL AND INSTALLATION TO PREVENT PERSONAL INJURY OR DAMAGE TO COMPONENTS.

7. Remove the frame hanger.


#### ASSEMBLY

18

- 1. Mount the new frame hanger to the frame rail, see vehicle manufacturer's recommended torque specification for proper torque values.
- 2. Completely lower the vehicle.
- 3. Install the M12 fasteners into the load spring rebound bracket and frame hanger. Tighten to 125 ± 5 Nm torque, see Figure 8-2.

🗚 WARNING



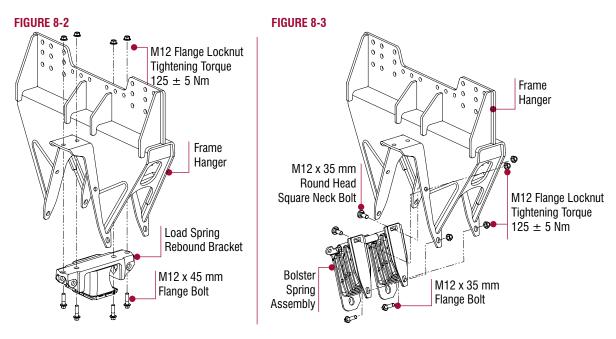

- 4. Install the tie-bar bolster spring assembly to frame hanger and tighten to  $\square$  125  $\pm$  5 Nm torque, see Figure 8-3.
- 5. Install the upper rebound strap fastener and tighten to  $3125 \pm 5$  Nm torque, see Figure 8-4.
- 6. Remove wheel chocks.

# **REBOUND STRAP**

#### DISASSEMBLY

- 1. Chock the front wheels of the vehicle.
- 2. Remove and discard the M12 upper and lower rebound strap M12 fasteners and spacers, see Figure 8-1.
- 3. Slide the rebound strap out of the saddle assembly.
- 4. Remove and discard rebound strap.


THE REBOUND STRAP MUST BE

INSTALLED WITH THE SEWN AREA

#### ASSEMBLY



NOTE

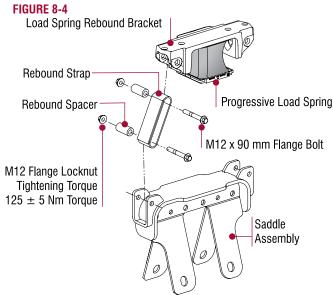

FACING AWAY FROM THE SADDLE
AND EQUALIZING BEAM. FAILURE TO DO SO WILL RESULT IN PREMATURE WEAR OF THE REBOUND STRAP.
1. Slide the rebound spacer through lower rebound strap loop.
Ensure the sewn area on rebound strap is facing away from the saddle and equalizing beam.
2. Install the M12 fasteners into the saddle assembly.


- 3. Tighten the M12 fastener to  $\blacksquare$  125  $\pm$  5 Nm torque, see Figure 8-4.
- Slide the rebound spacer through the upper rebound strap loop.
- 5. Install the M12 fasteners into the load spring rebound bracket.
- 6. Tighten the M12 fastener to  $\bigcirc$  125  $\pm$  5 Nm torque, see Figure 8-4.
- 7. Remove the wheel chocks.

# **TIE-BAR BOLSTER SPRINGS**

**FIGURE 8-5** 

#### DISASSEMBLY


- 1. Chock the front wheels of the vehicle.
- 2. Remove upper rebound strap fasteners.
- 3. Remove the M12 fasteners from the frame hanger to the tie-bar bolster springs, see Figure 8-5.
- 4. Remove the tie-bar bolt and spacer.
- 5. Raise the rear of the vehicle frame to clear the tie-bar bol-

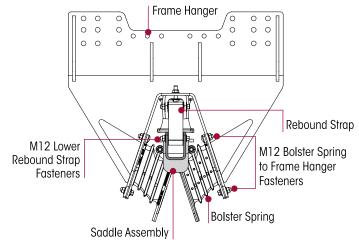

ster springs from the equalizing beam. Support the vehicle frame at this height with safety stands.

- 6. Remove the upper M12 fasteners that connect the tie-bar bolster springs to the saddle assembly, see Figure 8-6.
- 7. Remove the lower M20 fasteners connecting the tie-bar bolster springs to the equalizing beam, see Figure 8-6.
- 8. Remove the tie-bar bolster springs, see Figure 8-6.

#### FIGURE 8-6

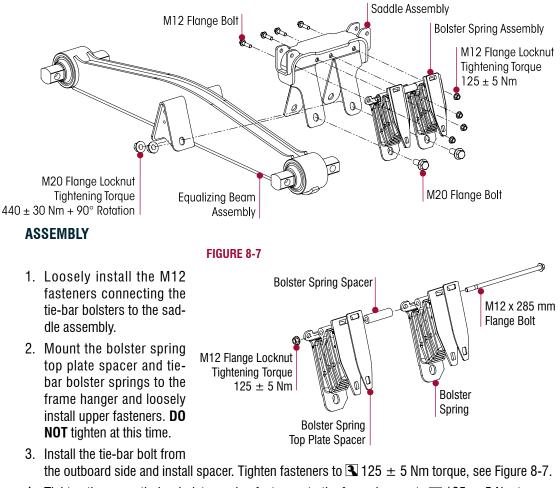

4. Tighten the upper tie-bar bolster spring fasteners to the frame hanger to  $\bigcirc$  125  $\pm$  5 Nm torque, see Figure 8-3.





- 5. Lower the vehicle.
- 6. Install the lower tie-bar M20 fasteners to the equalizing beam and tighten to  $3440 \pm 30$  Nm + 90° rotation torque, see Figure 8-6.
- 7. Tighten the tie-bar bolster springs M12 fasteners to the saddle to  $\blacksquare$  125  $\pm$  5 Nm torque, see Figure 8-6.
- 8. Install the upper rebound strap fasteners and spacer. Tighten fasteners to  $\square$  125  $\pm$  5 Nm torque.
- 9. Remove wheel chocks.

## **PROGRESSIVE LOAD SPRING**


**SERVICE HINT** Tire removal is not necessary for the replacement of the load spring.

#### DISASSEMBLY

- 1. Chock the front wheels of the vehicle.
- 2. Remove the M12 upper rebound strap fasteners and spacers.
- 3. Raise the vehicle until the suspension is fully extended with the tires completely off the ground. Support the frame at this height with safety stands.
- 4. Remove M12 fasteners from frame hanger to progressive load spring assembly.

5. Remove the progressive load spring from the load spring rebound bracket, see Figure 8-8.



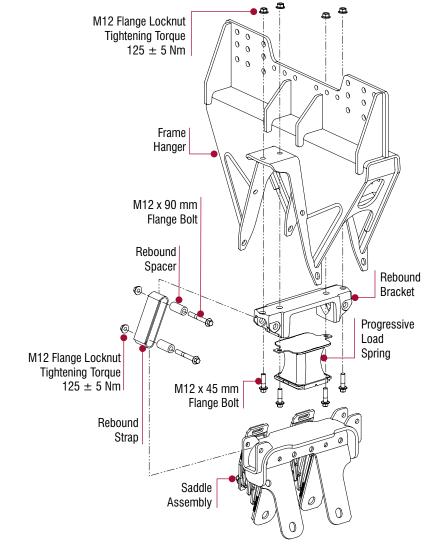



#### ASSEMBLY


- 1. Install the new progressive load spring to the load spring rebound bracket.
- Attach the new progressive load spring assembly and connect to the frame hanger. Tighten to
   125 ± 5 Nm torque, see Figure 8-8.
- 3. Lower the frame.
- 5. Remove the wheel chocks.

#### SADDLE ASSEMBLY

#### DISASSEMBLY

- 1. Chock the front wheels of the vehicle.
- 2. Remove the M12 fasteners from the frame hanger to the tie-bar bolster springs, see Figure 8-9.
- 3. Remove the M12 fasteners from frame hanger to load spring rebound bracket, see Figure 8-9.
- 4. Remove the lower fastener and spacer from the rebound straps, see Figure 8-9.
- 5. Remove the tie-bar bolt and spacer.
- 6. Raise the rear of the vehicle enough to clear the frame hanger from the equalizing beam. Support the vehicle at this height with safety stands.
- 7. Slide the progressive load spring assembly out of the saddle assembly.
- 8. Remove the M12 fasteners connecting the tie-bar bolster springs to the saddle assembly.
- 9. Remove M20 fasteners connecting the tie-bar bolster springs to the equalizing beam, see Figure 8-9.
- 10. Remove the bolster springs.
- 11. Remove the saddle assembly.


#### FIGURE 8-9

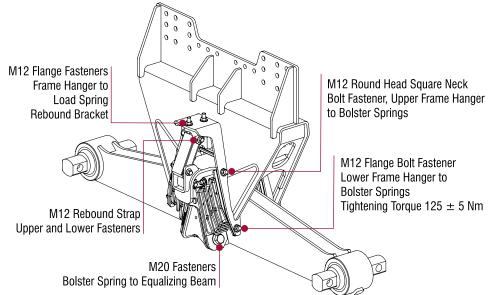

#### ASSEMBLY

- 1. Place the saddle assembly on the equalizing beam.
- 2. Position the tie-bar bolster springs to the saddle assembly.
- 3. Install the M12 and M20 fasteners and hand tighten, **D0 N0T** tighten at this time, see Figure 8-9.
- 4. Install the tie-bar bolster springs, see Tie Bar Bolster Spring in this Section.



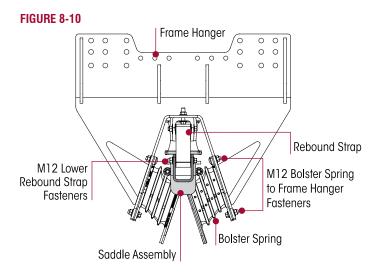

- 5. Install the progressive load spring assembly to the frame hanger and tighten fasteners to  $3125 \pm 5$  Nm torque.
- 6. Lower the vehicle.
- 7. Install upper tie-bar bolster springs fasteners to the frame hanger. Tighten fasteners to 1 125  $\pm$  5 Nm torque, see Figure 8-10.
- 8. Install the M12 lower rebound strap fasteners and spacer into the saddle assembly, see Figure 8-10.
- 9. Tighten the lower rebound strap fasteners to 3 125  $\pm$  5 Nm torque.
- 10. Remove the wheel chocks.

# **EQUALIZING BEAM**

#### DISASSEMBLY

- 1. Chock the FRONT wheels of the vehicle.
- 2. If both equalizing beams need replacement repeat Steps 3 through 8 for removal of the opposing equalizing beam **AFTER** the first equalizing beam is installed.
- 3. Remove lower tie-bar bolster spring M20 fasteners on both equalizing beams.
- 4. Raise and support frame with safety stands.

**A** WARNING

THE WEIGHT OF THE EQUALIZING BEAM ASSEMBLY IS APPROXIMATELY 62.2 KILOGRAMS. PRIOR TO REMOVING THE BAR PIN BOLTS FROM THE EQUALIZING BEAM, SUPPORT THE END OF THE EQUALIZING BEAM TO PREVENT FROM DROPPING. CARE SHOULD BE TAKEN AT REMOVAL AND INSTALLATION TO PREVENT PERSONAL INJURY OR DAMAGE TO COMPONENTS.

- 5. Support the equalizing beam being serviced.
- 6. Remove and discard bar pin fasteners that connect the end bushing bar pin to the axle bracket.
- 7. Lower the equalizing beam from the axle brackets and remove from vehicle.

#### ASSEMBLY

**NOTE** All W&C-TRR equalizing beams are manufactured with the bar pin flats perpendicular to the equalizing beam's axis. It is not necessary to adjust the bar pins to the same pinion angle as prior to disassembly. The rubber in the bushings will gradually allow the bar pins to adapt to the pinion angles of the drive axles. This is a normal function of the bar pin bushings.

SERVICE HINT


**WARNING** 

THE WEIGHT OF THE EQUALIZING BEAM ASSEMBLY IS APPROXIMATELY 62.2 KILOGRAMS. CARE SHOULD BE TAKEN AT REMOVAL AND INSTALLATION TO PREVENT PERSONAL INJURY OR DAMAGE TO COMPONENTS.


Installing the front bar pins prior to the rear bar pins will ease in the installation of the equalizing beam.

- 1. Mount the equalizing beam into the  $\ensuremath{\textbf{FRONT}}$  drive axle bracket.
- 2. Chock the **REAR** drive axle wheels to prevent movement while installing the rear bar pin into the axle bracket.
- 3. Support the current axle position of the rear axle pinion with a jack to assist with the installation of the rear bar pin.
- 4. Disconnect the rear V-torque rod from the torque rod axle bracket.
- 5. Lower the rear drive pinion until the axle bracket legs are parallel to the rear bar pin flats, see Figure 8-11.
- $\label{eq:constraint} \textbf{6.} \quad \textbf{Mount the equalizing beam into the REAR drive axle brackets.}$
- 7. Install NEW bar pin fasteners. **DO NOT** tighten at this time.

- 8. Install the rear V-torque rod to the torque rod axle bracket. Tighten the fasteners to the vehicle manufacturer's specifications.
- 9. Tighten the bar pin fasteners to vehicle manufacturer's specification.
- 10. Lower the vehicle.

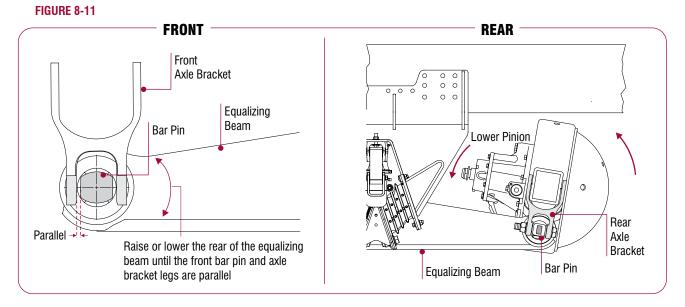

11. Install the M20 fasteners connecting bolster to the equalizing beam and tighten to  $3440 \pm 30 \text{ Nm} + 90^{\circ}$  rotation torque, see Figure 8-12.

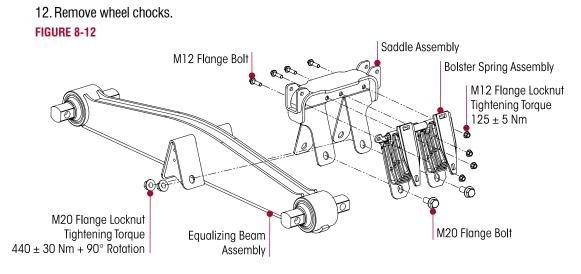

# **BAR PIN END BUSHINGS**

#### You will need:

- A shop press with a capacity of at least 45 metric tones, End bushing kit (see Parts List Section of this publication), Bar pin installation, removal and a shop made receiving tools (Refer to Special Tools Section of this publication.)
- **A** WARNING

WHEN REMOVING AND INSTALLING BUSHINGS IN THE EQUALIZING BEAMS, FOLLOW THE PROCEDURES OUTLINED IN THIS PUBLICATION. DO NOT USE A CUTTING TORCH TO REMOVE THE BUSHING OUTER METALS PRESSED IN THE BEAM BORES OR FASTENERS. WELDING, TORCHING OR ATTACHING MATERIAL TO THE EQUALIZING BEAM MUST NEVER BE PERFORMED. THE USE OF HEAT CAN ADVERSELY AFFECT THE STRENGTH OF THE EQUALIZING BEAMS.



DISCARD USED FASTENERS. ALWAYS USE NEW FASTENERS TO COMPLETE A REPAIR. FAILURE TO DO SO COULD RESULT IN FAILURE OF THE PART OR MATING PARTS, ADVERSE VEHICLE HANDLING, PERSONAL INJURY, OR PROPERTY DAMAGE.




NOTE

Watson & Chalin China recommends the use of Class 10.9 bolts, hardened washers, and Class 10 locknuts. Hardened washers are not necessary when flange head fasteners are used.

#### **BUSHING REMOVAL**

- 1. Remove the equalizing beam from vehicle as detailed in the Equalizing Beam Disassembly instructions in this section.
- Place the equalizing beam in the shop press with the beam end hub squarely supported on the receiving tool.
- 3. Prior to removal, note the orientation of the bar pin flats, see Figure 8-13. Mark orientation on the equalizing beam with a paint stick.
- 4. Press on the end bushing inner metal, see Figure 8-14, of the end bushing until the inner metal is flush with the top of the beam end hub. This will dislodge the confinement washer and move the bushing rubber away from the outer metal of the bushing so the removal tool can be installed.

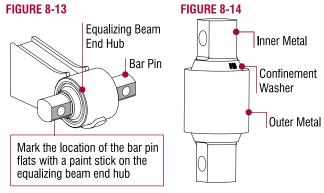

- 5. Center the end bushing removal tool directly on the bushing's outer metal (see Figure 8-14) and press the bushing out of the beam end hub.
- 6. After removing the equalizing beam end bushings, clean and inspect each beam end hub bore.

#### END HUB PREPARATION AND INSPECTION

 Clean the equalizing beam end hub bores with emery cloth or hone, removing any nicks or metal buildup

 Measure the equalizing beam end hub bore inner diameter and the bushing outside diameter. If components are **NOT** within the specified range, replacement is required.


DO NOT re-bush or otherwise use an equalizing beam that has been damaged.

FAILURE TO REPLACE AN EQUALIZING BEAM THAT HAS BEEN DAMAGED FROM BUSHING REMOVAL CAN RESULT IN THE FAILURE OF THAT BEAM, LEADING TO ADVERSE VEHICLE HANDLING AND POSSIBLE PERSONAL INJURY OR PROPERTY DAMAGE.

When installing bar pin end bushings the following steps will minimize the chance of damaging a new bar pin end bushing:

FIGURE 8-15



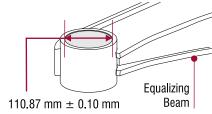

The Watson & Chalin China specification for the 110.87 mm ± 0.10 mm equalizing beam end hub bore diameter is 110.97 mm / 110.77 mm, see Figure 8-15.

#### **END BUSHING INSTALLATION**

from bushing removal.

**SERVICE HINT** 

WARNING

The equalizing beam bore may have a more substantial lead chamfer at one end of the bore than the other. Take advantage of the larger chamfer by pressing in the new end bushing from this end.

- 1. Place the equalizing beam in a shop press with the end hub, see Figure 8-16, squarely supported on the receiving tool.
- 2. Install the end bushing installation tool (refer to Special Tools Section of this publication) on the new end bushing as shown in Figure 8-16. Tighten the through bolt until the two halves of the tool meet.
- Lubricate the inside diameter of the equalizing beam end hub AND the bar pin end bushing's outer metal with a heavy layer of NLGI #2 – EP (Extreme Pressure) lithium base grease, see Figure 8-16.




4. Position the bar pin end bushing and installation tool on the equalizing beam end hub. Verify the end bushing is in line with the alignment mark made prior to removal.

NOTE

A CAUTION

The end bushing must be square with the equalizing beam end hub before pressing the end bushing into the beam. End bushings pressed in at an angle will damage the end bushing and the equalizing beam.

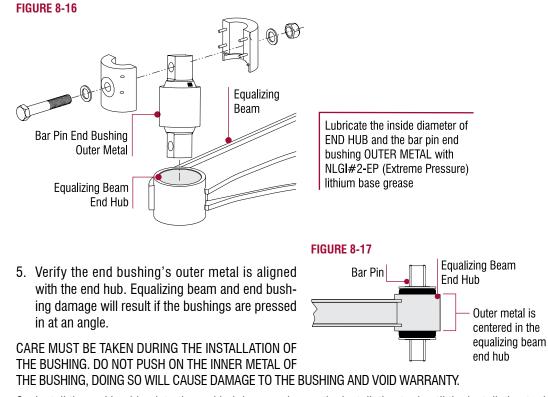

- 6. Install the end bushing into the end hub by pressing on the installation tool until the installation tool contacts the end hub. This will center the bushing in the end hub, see Figure 8-17.
- 7. Install the equalizing beam assembly into vehicle as detailed in Equalizing Beam assembly instructions in this section.



# SECTION 9 Troubleshooting Guide


# **W&C-TRR FOR YUTONG TRUCKS**

TROUBLESHOOTING GUIDE				
CONDITION	POSSIBLE CAUSE	CORRECTION		
Suspension has harsh	Damaged progressive load spring	Replace the progressive load spring		
or bumpy ride	Damaged tie-bar bolster springs assembly	Replace the tie-bar bolster springs assembly		
	Damaged progressive load spring	Replace the progressive load spring		
Vehicle leans	Damaged tie-bar bolster springs assembly	Replace the tie-bar bolster springs assembly		
Irregular tire wear	Bent axle	Replace the axle housing		
	Suspension is overloaded	Redistribute the load to correct weight and replace the bolster springs		
Bulged tie-bar bolster springs	Worn progressive load spring	Replace the progressive load spring and replace the bolster springs		
	Axles not centered	Center the axles under frame rails and replace the bolster springs		
	Suspension is overloaded	Redistribute the load to correct the weight		
Loose saddle assembly		Increase the fastener inspection intervals		
fasteners	Frequent hard stop/start	Review the driving habits to reduce the frequency of hard stop/start		
Outboard frame bracket cracked	Suspension is overloaded	Redistribute the load to correct weight		
Saddle leg to equalizing beam contact	Axles not centered	Center the axles under frame rails		



# SECTION 10 Torque Specifications

WATSON & CHALIN CHINA RECOMMENDED TORQUE VALUES PROVIDED IN NEWTON METERS

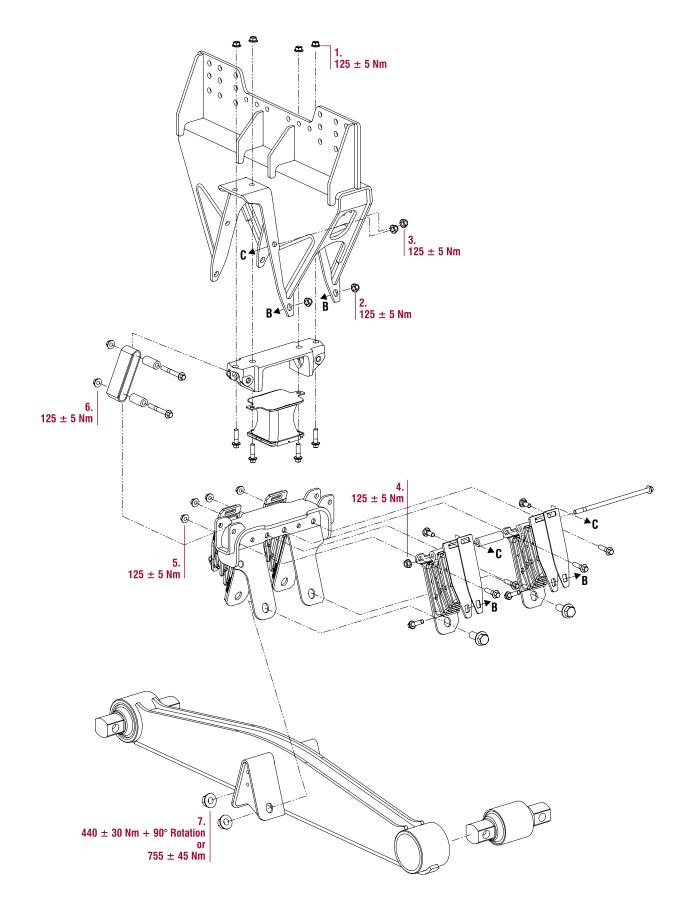



# W&C-TRR for Yutong Trucks

NO.	COMPONENT	FAS	<b>*TORQUE VALUE</b>	
		SIZE	QUANTITY	IN NEWTON METERS
Fram	e Fasteners furnished and installed by Truck Manufactur	er		1
1	Frame Hanger to Progressive Load Spring Rebound Bracket		8	
2	Frame Hanger to Lower Tie-bar Bolster Spring		8	
3	Frame Hanger to Upper Tie-bar Bolster Spring	M12	8	125 ± 5
4	Tie-bar Bolster Spring		4	
5	Tie-bar Bolster Spring to Saddle Assembly		8	
6	Saddle Assembly to Rebound Strap		4	
7	Tie-bar Bolster Spring to Equalizing Beam	M20	8	$440 \pm 30 + 90^{\circ}$ rotation or 755 $\pm 45$





Actual product performance may vary depending upon vehicle configuration, operation, service and other factors. All applications must comply with applicable Watson & Chalin China specifications and must be approved by the respective vehicle manufacturer with the vehicle in its original, as-built

configuration.

Contact Watson & Chalin China for additional details regarding specifications, applications, capacities, and operation, service and maintenance instructions.

# Contact Watson & Chalin China at +86 531 8880 9055 for additional information.



Watson & Chalin China No. 1668 North Section of Chunbo Road East New Dist of Jinan High- Tech Industrial Development Zone Jinan City, Shandong Province, China, 250104 +86 531 8880 9055 • Fax +86 531 8880 9059

china.wcsuspensions-intl.com

W&C283 TP Rev A 09-23 Watson & Chalin is a brand of Hendrickson Printed in United States of America